Mouse Function Quick Reference

Using the Mouse Wheel to Change the View

Zoom Out

Zoom In

Pan Right

Pan Left

+ Shift Key

Pan Up

Pan Down

+ Ctrl Key

CW Rotation
Horizontal Axis

+ Alt Key

CCW Rotation
Horizontal Axis

CW Rotation
Vertical Axis

Shift + Alt Key

CCW Rotation
Vertical Axis

CW Rotation
Screen Z Axis

Ctrl + Alt Key
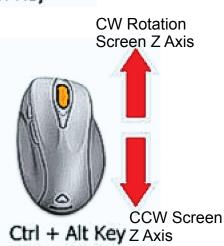
CCW Screen
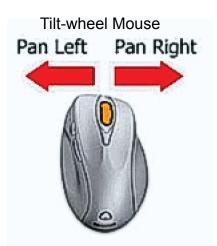Z Axis

Tilt-wheel Mouse

Pan Left   Pan Right

Forward (1) & Back (2) Buttons

1 = Advance cutter 1 position in the active
cutter path.
2 = Move cutter backwards 1 position in the
active cutter path.

Left & Right Mouse Buttons

Left-Click - in select mode, select only the cutter path or geometry near the cursor.

Left-Down and Hold - draw a cursor stroke on the screen. Release to execute a command associated with the shape of the stroke.

Ctrl+Left Click - in select mode, toggle the state of selection of the entity nearest the cursor.

Shift+Left Click - move the center of rotation of the on-screen track ball to the location nearest the cursor.

Right-Click - posts a context sensitive menu. Contents of the menu are related to the current feature or function you are doing.